




408 Series Freezeless Wall Hydrant

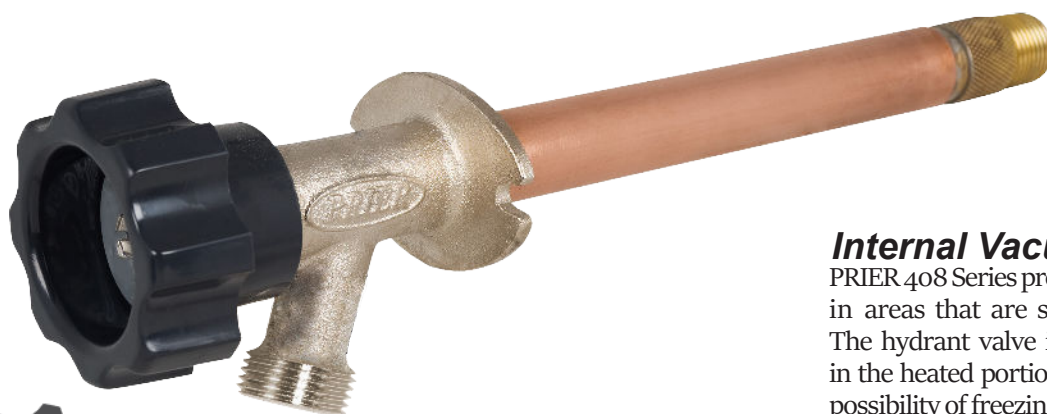

- Residential
- Freezeless
- Anti-Siphon
- Backflow Check Valve

Internal Vacuum Breaker

PRIER 408 Series provides a year round source of water in areas that are subject to freezing temperatures. The hydrant valve is connected to the supply piping in the heated portion of the structure, eliminating the possibility of freezing. The PRIER 408 Series features a half turn design for years of easy operation.

The PRIER 408 Series has all the characteristics of the historically proven 400 Series Wall Hydrant, but the design of the 408 Series incorporates the vacuum breaker and backflow preventer into the operating stem, eliminating an external vacuum breaker on top of the valve.

FEATURES

- Internal vacuum breaker and backflow preventer
- Easy half-turn operation
- Integral cast flange with built-in drainage pitch
- Wide screw holes easily secure mounting screws
- Solid brass body and seat
- Per ASSE 1019, pressure rated to 125 PSI, temperature to 140°
- Satin nickel plated body maintains an attractive finish
- Stainless steel & brass screws
- Easy grip polycarbonate operating handle
- EPDM packing for easy maintenance
- Each valve air-tested at factory for leak-free quality
- Spout aligning mark with manufacturer's date code

ORDERING

408-10

Inlet

08-D- 1/2" MPT x 1/2" SWT
09-T- 3/4" MPT x 1/2" FPT
12-F- 3/4" SWT
20-X- 1/2" Crimp PEX
21-W- 1/2" Wirsbo® PEX


Length

04- 4" Insertion
06- 6" Insertion
08- 8" Insertion
10- 10" Insertion
12- 12" Insertion
14- 14" Insertion

INLET STYLES



D Style
1/2" MPT x 1/2" SWT

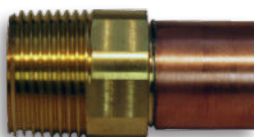


T Style
3/4" MPT x 1/2" FPT



F Style
3/4" SWT



X Style
1/2" Crimp PEX



W Style
1/2" Wirsbo® PEX


4515 E. 139th Street Grandview, MO 64030 | (800) 362-9055 | PRIER.com

*Per ASSE 1019 Code, do not leave on for more than 12 continuous hours.

408-P



408 SERIES REPLACEMENT PARTS

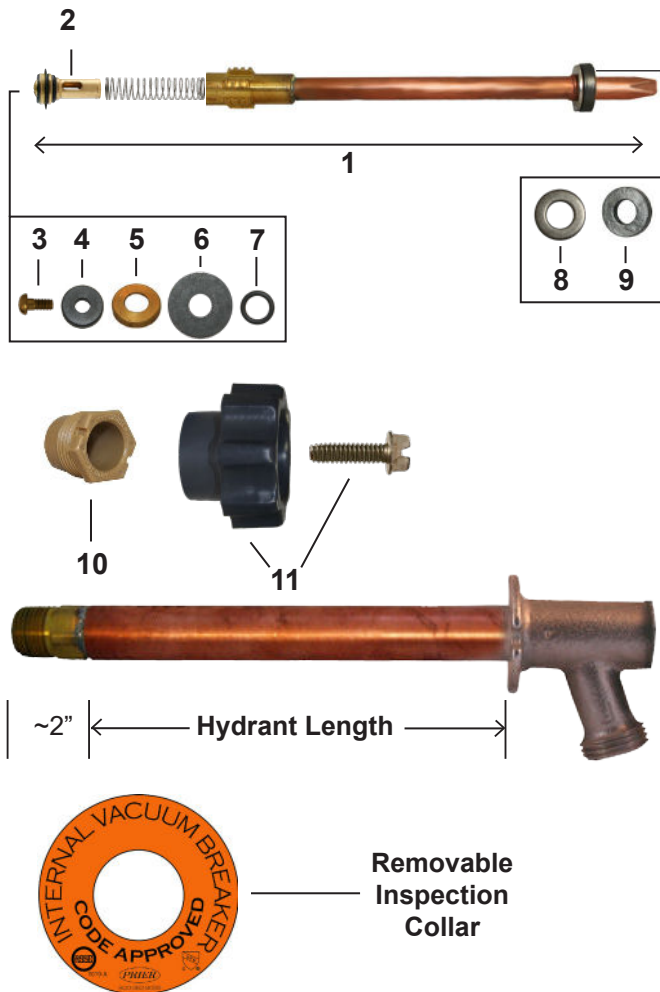

ID	Part No.	Description
1	See Replacement Stem Section	Stem Assembly Contains: 1, 8, 9
2	231-3201	BFP Assembly
3	910-3008	Bibb Screw (Brass)
4	936-3012	Bibb Washer (Rubber)
5	310-3016	Cage Washer (Brass)
6	936-3011	BFP Washer (Rubber)
7	936-3002	Stem End O-Ring (Rubber)
8	324-1006	Washer (Stainless Steel)
9	336-0044	Packing for Left Hand Packing Nut
10	337-3001	Left Hand Thread Packing Nut (Plastic)
11	630-7965	Handle & Screw Kit (Grey Plastic Handle & Stainless Steel Screw)
	630-7755	Service Kit for 300/400/500 Series Contains: 3, 4, 5, 6, 7, 8, 9, 10

*The 630-7755 Wall Hydrant Service Kit includes parts for the 300, 400 and 500 Series hydrants, some of which are not pictured here. When repairing a hydrant you will have parts left over.

REPLACEMENT STEMS



Part No.	Stem Length	Description
M-123-4090	7 ³ / ₄ " OAL	Stem for 400 Series 4" Hydrant
M-123-4092	9 ³ / ₄ " OAL	Stem for 400 Series 6" Hydrant
M-123-4093	11 ³ / ₄ " OAL	Stem for 400 Series 8" Hydrant
M-123-4094	13 ³ / ₄ " OAL	Stem for 400 Series 10" Hydrant
M-123-4095	15 ³ / ₄ " OAL	Stem for 400 Series 12" Hydrant
M-123-4096	17 ³ / ₄ " OAL	Stem for 400 Series 14" Hydrant

**400 Series stems are made to fit the 400, 408 and 400-LF Series Wall Hydrants only. They are not interchangeable with any other hydrants. For parts for Mansfield style anti-siphon hydrants made prior to 2007, see the retired 500 Series spec sheet.